



RELEASE NOTE FOR ROUTER F5D5230z4, FIRMWARE 1.20.003

DATE: APRIL 11, 2003

These release notes describe features and caveats. The main code module for this release is compatible and downloadable into the switch over the network using the TFTP protocol. Please refer to the Installation and User Guide for a detailed description of the download procedure.

Refer to the Belkin User Guide for information about using the embedded web management capability of the switch.

This version of software **F5D5230z4-v1.20.003-runtime.bin** supports the following models of the F5D5230-x product family:

?? **F5D5230z4**

RESOLVED ISSUES

1. Solve Telstra-BigPond disconnect and reconnect when BigPond server heartbeat response too slow.

PRE-RESOLVED ISSUES

V 1.2.0.002

1. Virtual server of Netmeeting does not work.
2. Increase setup convenience to setup other settings without necessarily indicating wan mode parameters.

V 1.20.001

1. After restore factory defaults, as long as dhcp client gets ip, system crashes

V 1.20.000

1. **EZ-Install API : Commit status wrong.**
The commit status packets do not indicate errors correctly. Instead of the status code appearing at offset 6 it appears at offset 7 of the packet. Offset 6 is always zero.
2. **EZ-Install API : The WAN MAC address should always be set regardless of the addressing or authentication mode.**
3. **EZ-Install API : No port close after 10 min.**
4. **Add EZ-Install API.**
5. **Add Release/Renew buttons in "Status" page.**
6. **Add non-standard FTP port configuration in "Virtual Server" page.**
7. **Add "Save Settings" button in "Tools" page to allow user to download gateway settings to a text file.**
8. **Fix SONY PS2 application compatibility problem.**

9. Incorrect entry in web server log file.
10. Setup "LAN Service" page failed when using Netscape 4.5 , 4.7.
11. Upgrade firmware fails when using IE on MAC OS X.
Change extension of firmware filename to .bin and add check in firmware to solve this problem.
12. Modify WAN driver access timer to fit new CPU (S3C4510B01).

V 1.00.003

1. Delay transmit rate of WAN driver to fix Bigpond disconnects problem.

V 1.00.001

1. Change the "Update Firmware" link to "http://www.belkin.com/anz/update"
2. Status page shows "disconnected" when router is connected in BigPond mode
3. Can not connect to most web sites when using ADSL (PPPoE).
Lower the MSS value of TCP connection initialization should be able to solve this problem
4. Router cannot work with simple mail server names such as "Mail".

V 1.00.000

1. Change entry name for BigPond in main menu and description in BigPond setup page; And add login server table in BigPond setup page.
2. Change technique support information of to be
Technical support: Australia 1-800-666-040
New Zealand 0800-441-913
Singapore 800-616-1793
Firmware upgrade link: http://www.belkin.com.au/update
Product information link: http://www.belkin.com.au/networking
Belkin Components homepage: http://www.belkin.com.au

LIMITATION & RESTRICTIONS:

APPROVED BY:

_____	_____
Submitted By:	Date
_____	_____
Product Manager	Date
_____	_____
Technical Support	Date

There are 2 types of firmware release, formal and engineering beta test version.

Formal version:

X.Y0 X: number from 1, Y: 0 - 9
Example: V1.00, and V1.10

Engineering Beta and Test version:

X.YZE X: number from 0, Y: 0 – 9 Z: 0 - 9
Example: V0.01E, V1.02E, or V1.14E